

## Lynk & Co 01 HEV Type: 5dr SUV (2021 - ) – Additional Pages




When conventional antifreeze/coolant leaks from the battery pack, it can become unstable with risk of thermal runaway. An increasing battery pack temperature might be an indicator of thermal runaway.



## 7. In case of submersion

- There is no increased risk of electric shock in water resulting from the high voltage system;
- If possible, remove the vehicle from the water and continue with the deactivation procedure for this vehicle (see chapter 3).

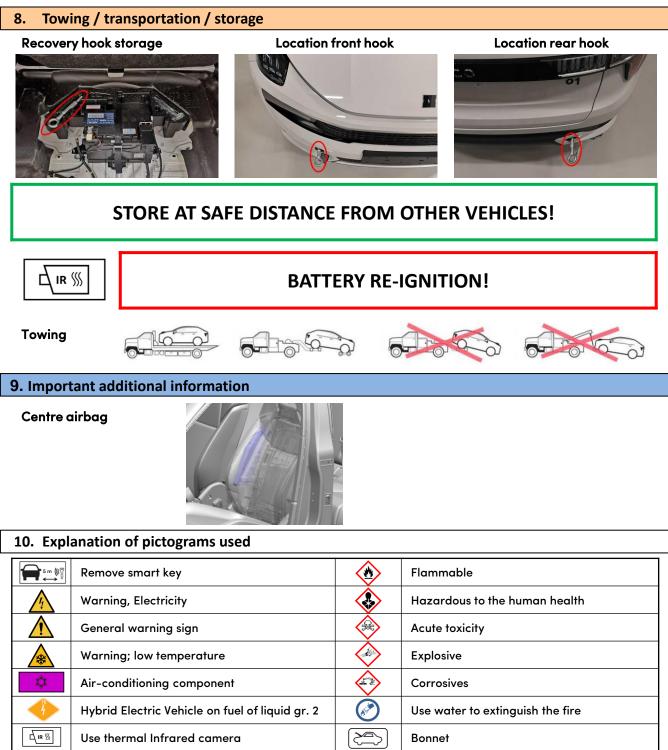

Trunk

Document N°

L6T-CX11-HEV-ENG

LYNK & CO in co-operation with Moditech Rescue Solutions B.V.

Version N°

1.0

Version date

01/2021

Page N°

4/4