




NEW COMPASS MY25 BEV
5 doors/ 5 seats/ SUV
(2025/ ->)

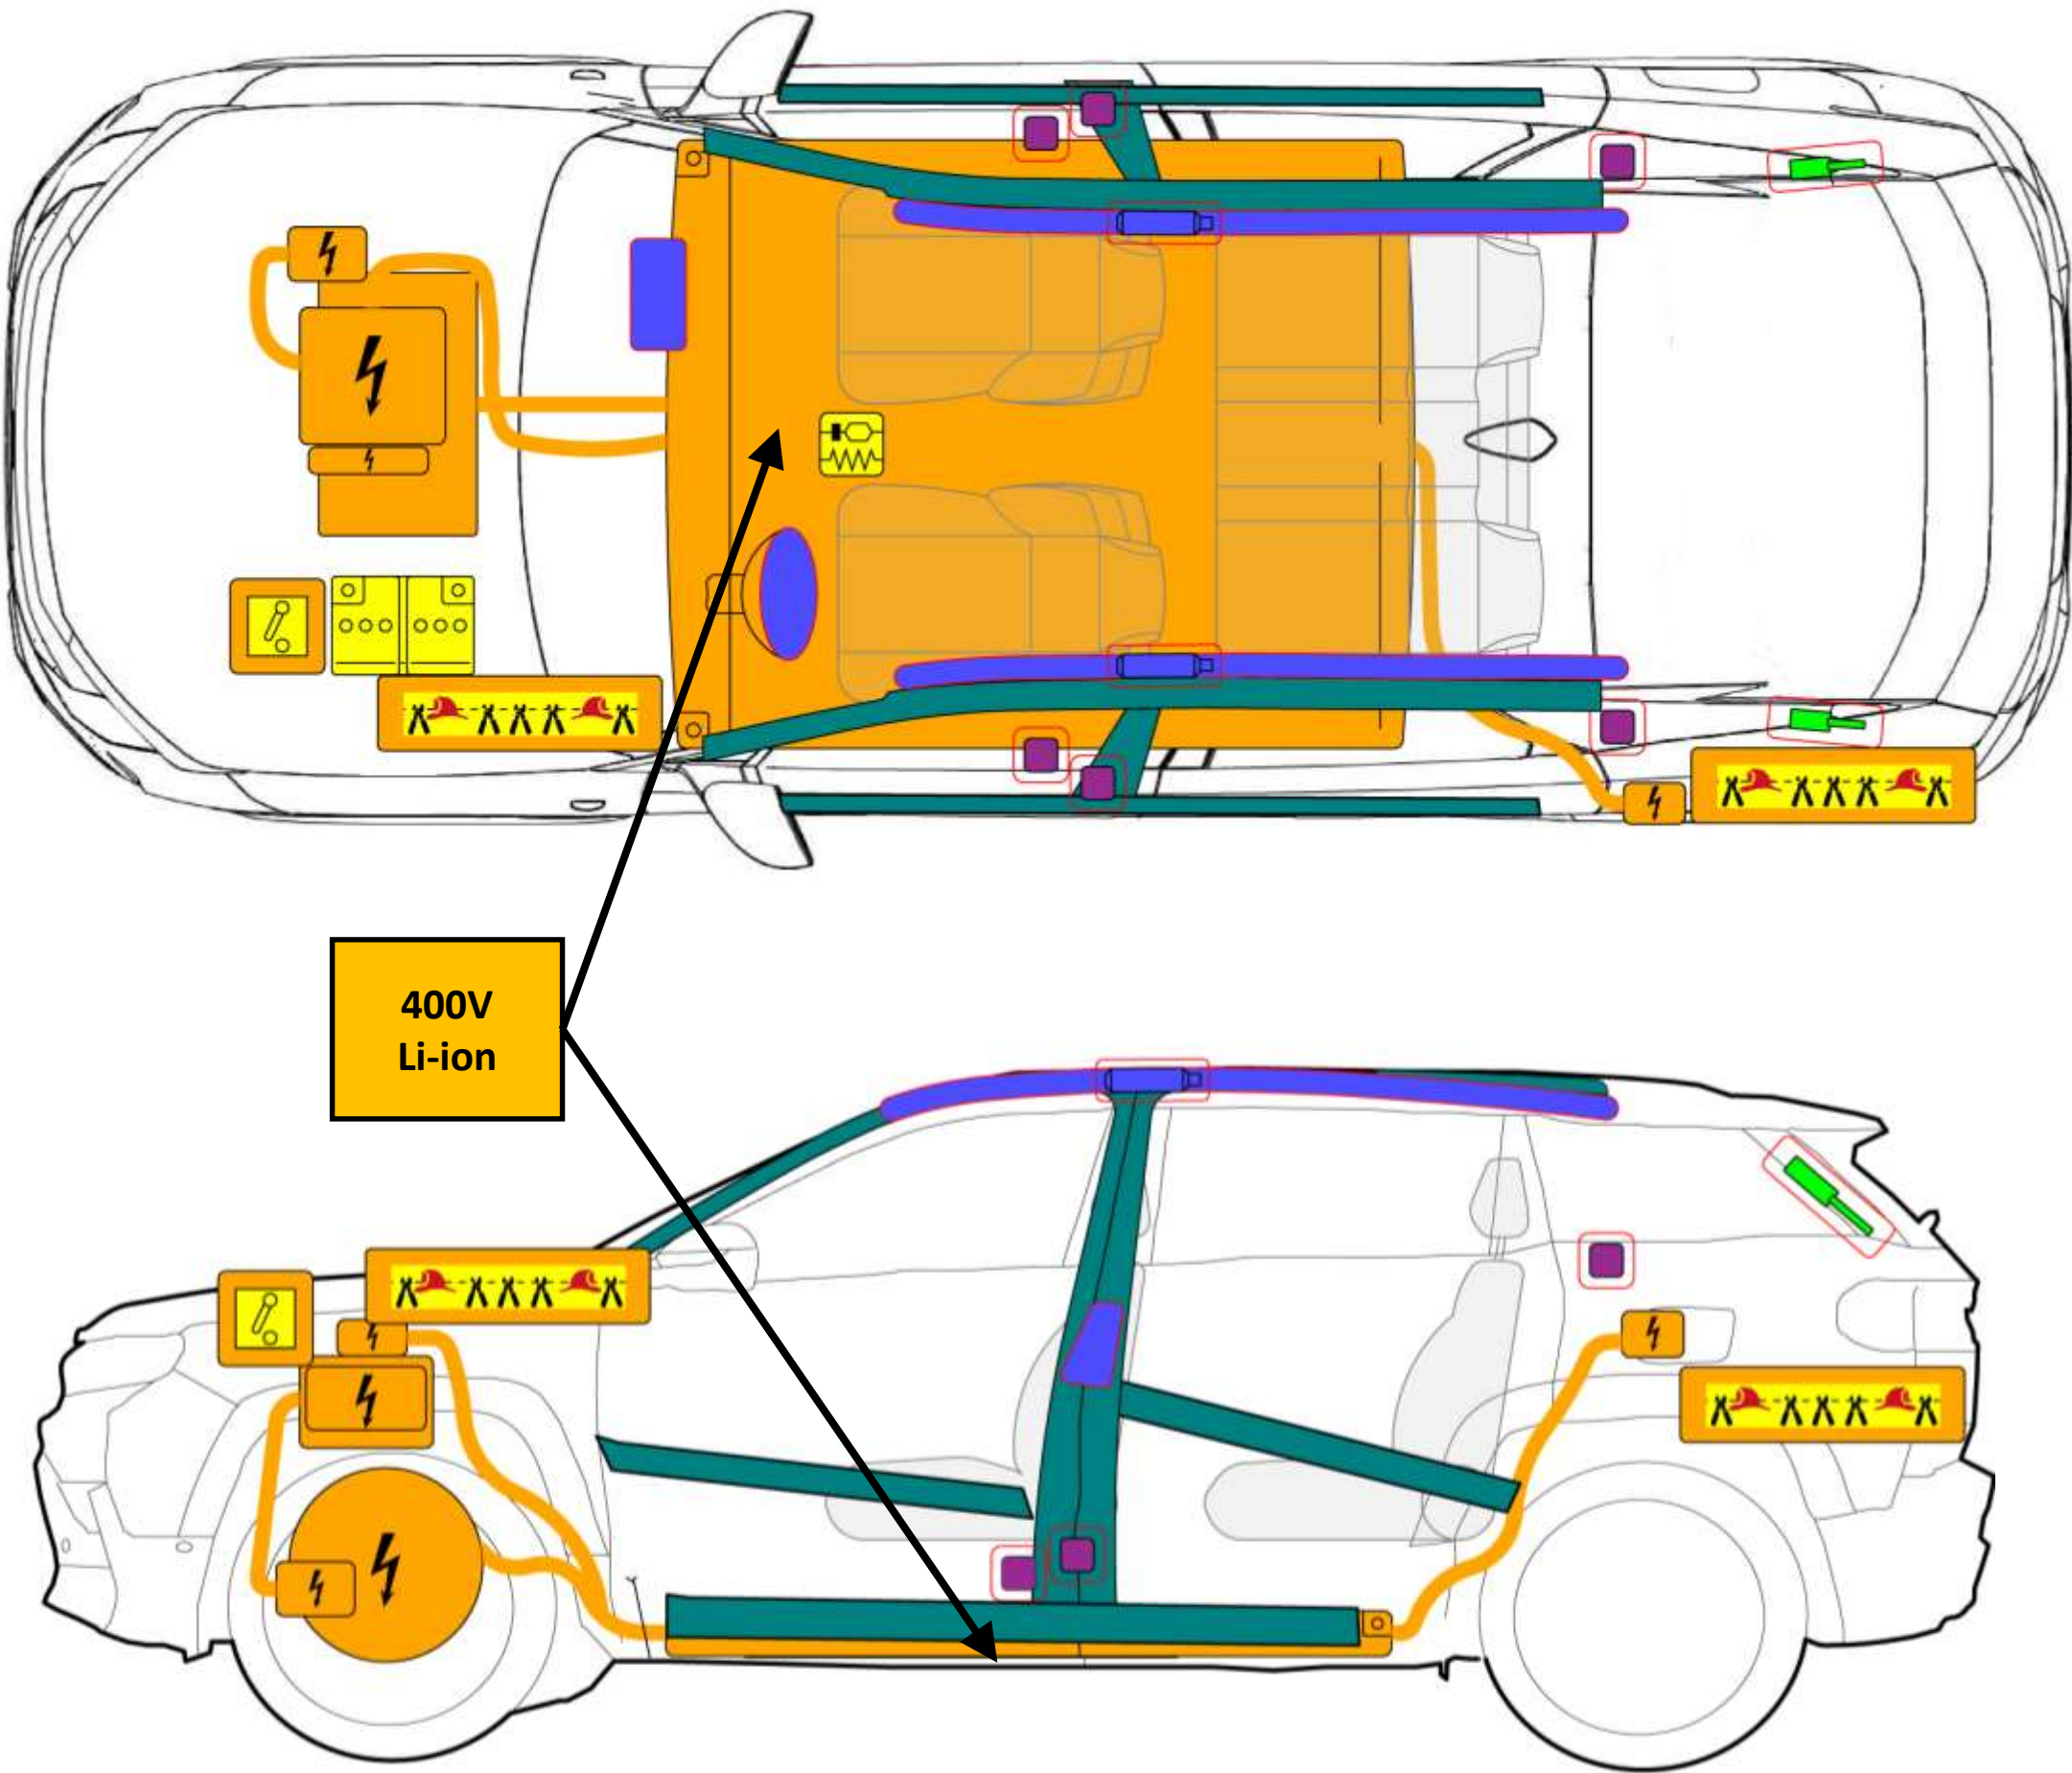

| | | | | | | | | | |
|--|----------------------------|--|--|--|------------------------|--|------------------|--|---------------------------|
| | Airbag | | Stored gas inflator | | Seat belt pretensioner | | SRS control unit | | |
| | | | Gas strut / Preloaded spring | | High strength zone | | | | High voltage component |
| | Battery low voltage | | | | | | | | |
| | Battery pack, high-voltage | | High voltage power cable | | | | | | |
| | Cable cut | | Low voltage device that disconnects high voltage | | | | | | |


1. Identification / recognition



LACK OF ENGINE NOISE DOES NOT MEAN VEHICLE IS OFF, SILENT MOVEMENT OR INSTANT RESTART CAPABILITY EXISTS UNTIL VEHICLE IS FULLY SHUT DOWN. WEAR APROPRIATE PPE.


Brand logo

Jeep

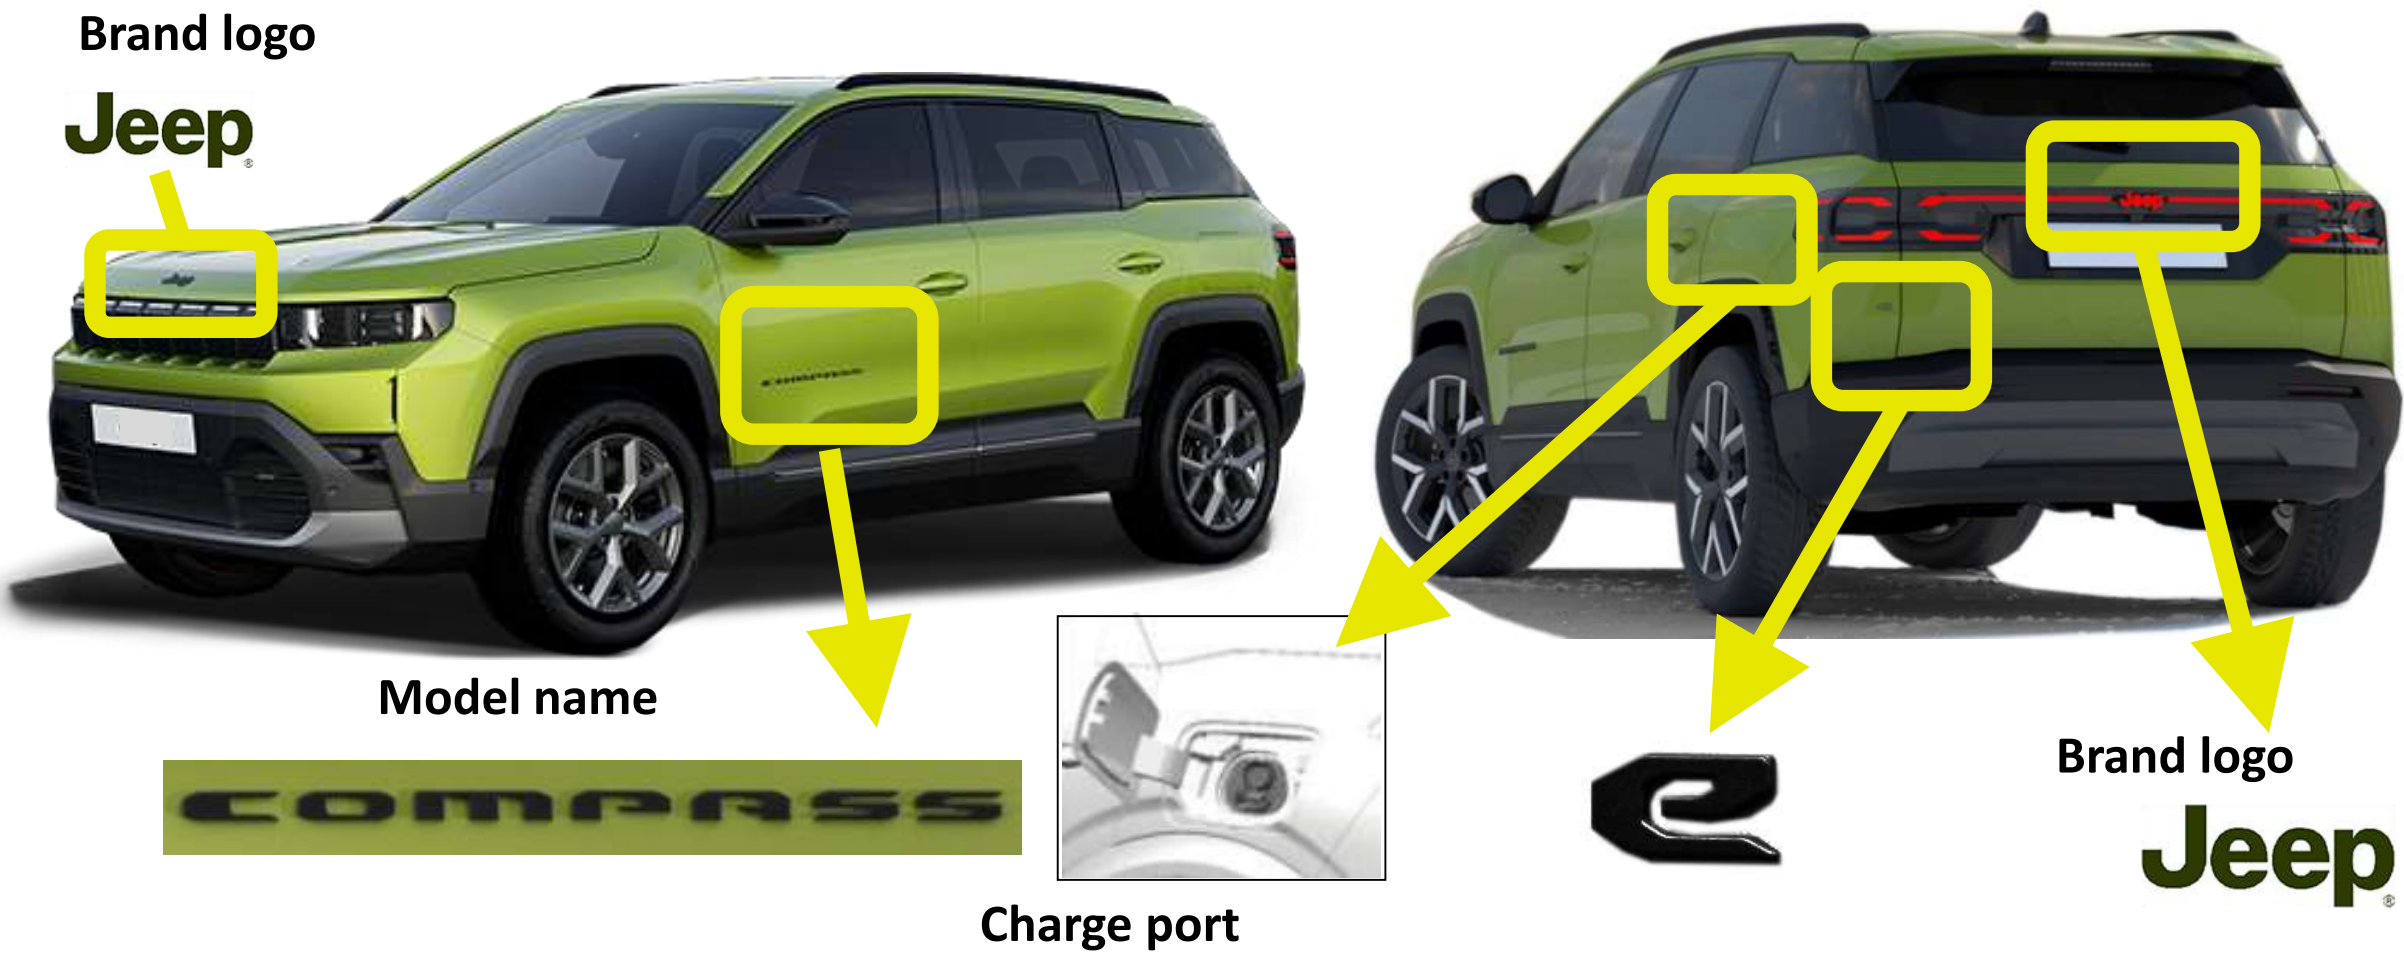

Model name

COMPASS

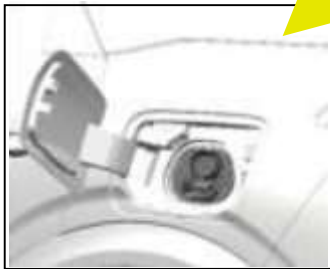

Charge port




Brand logo

Jeep

2. Immobilisation / stabilisation / lifting





Immobility

Stabilization/lifting points

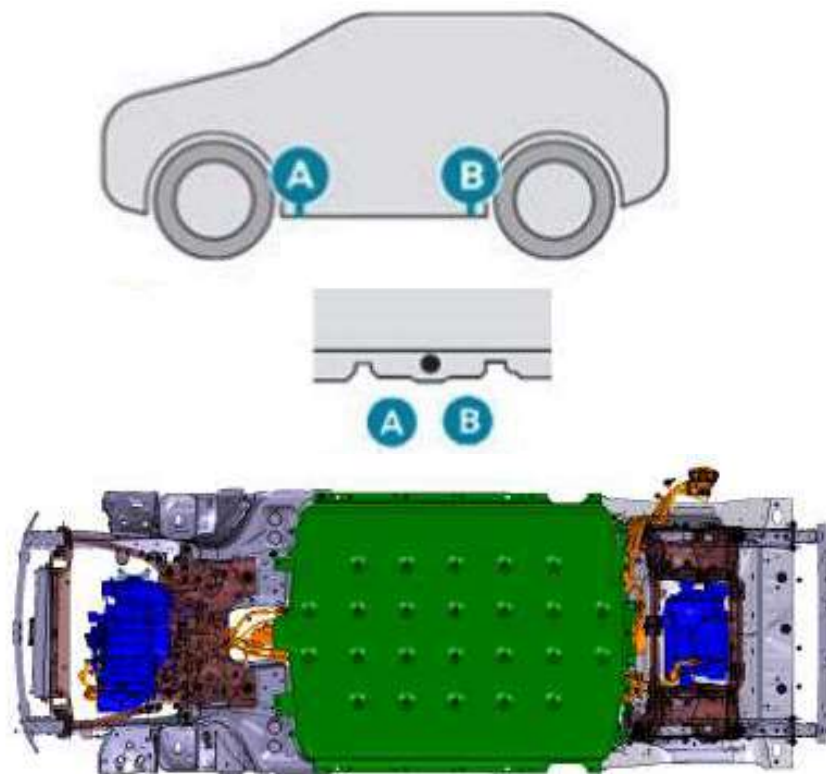




3. Disable direct hazards / safety regulations

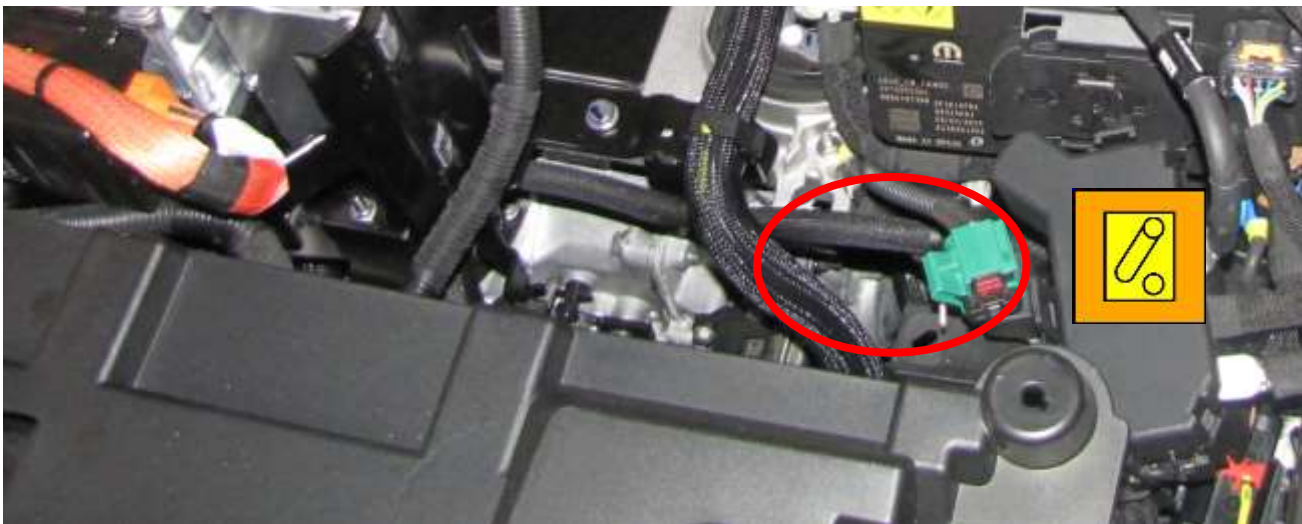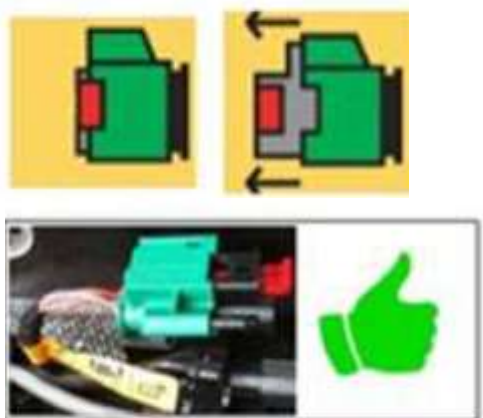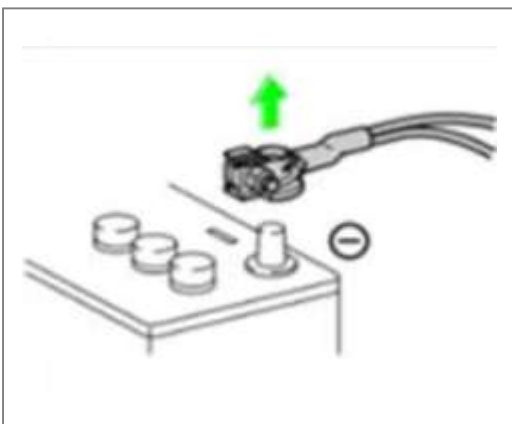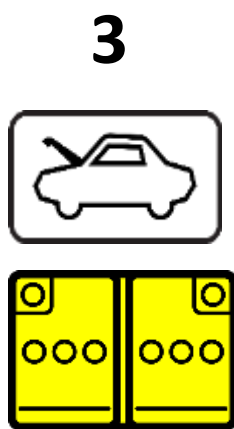
Main disabling method



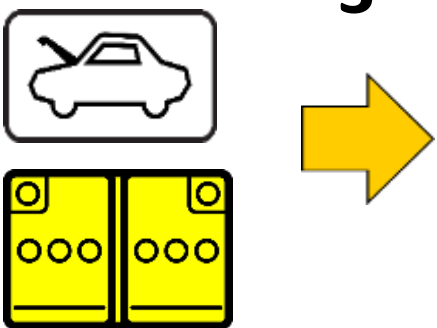


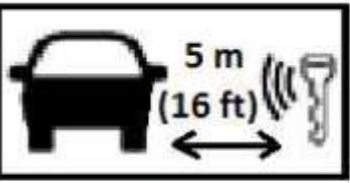


Alternative disabling methods

A




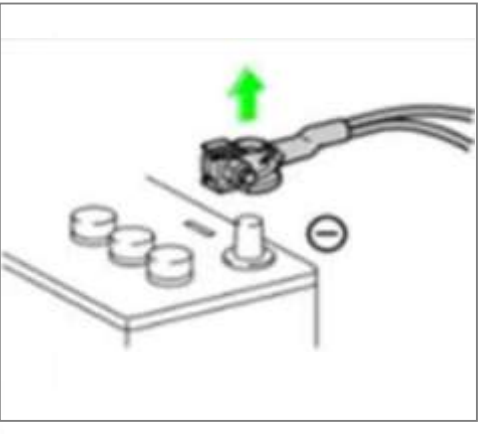










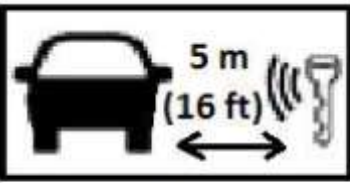





B



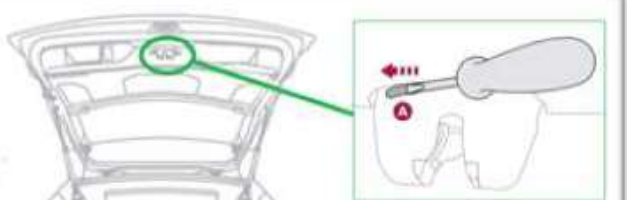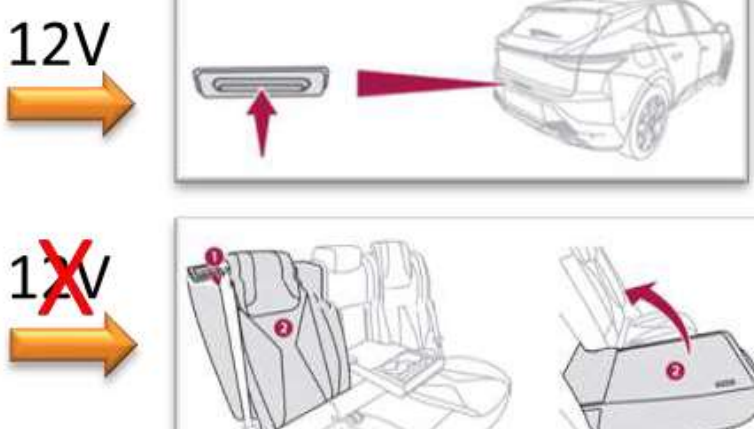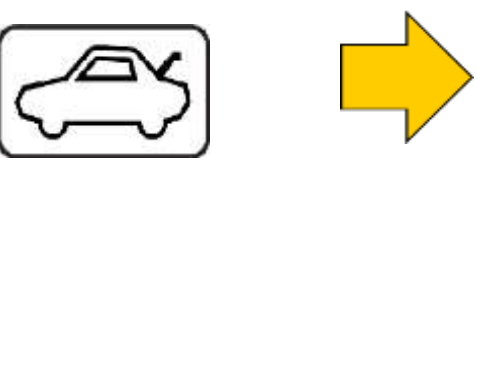

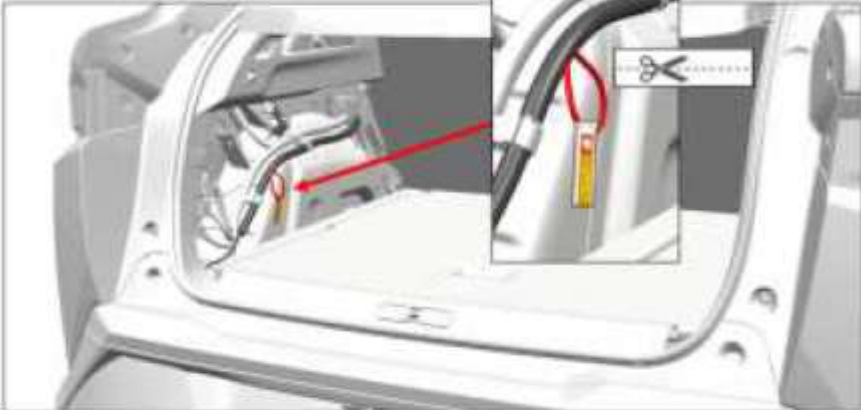

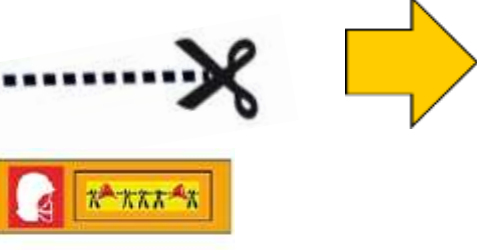






4. Access to the occupants




Toughened glass




Laminated glass

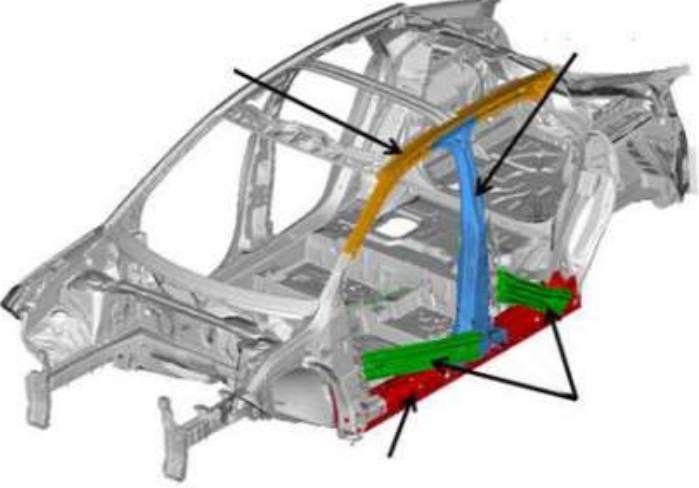


High strength steel body

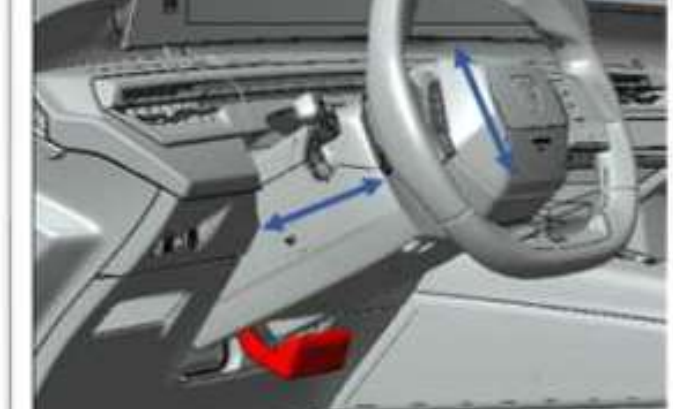








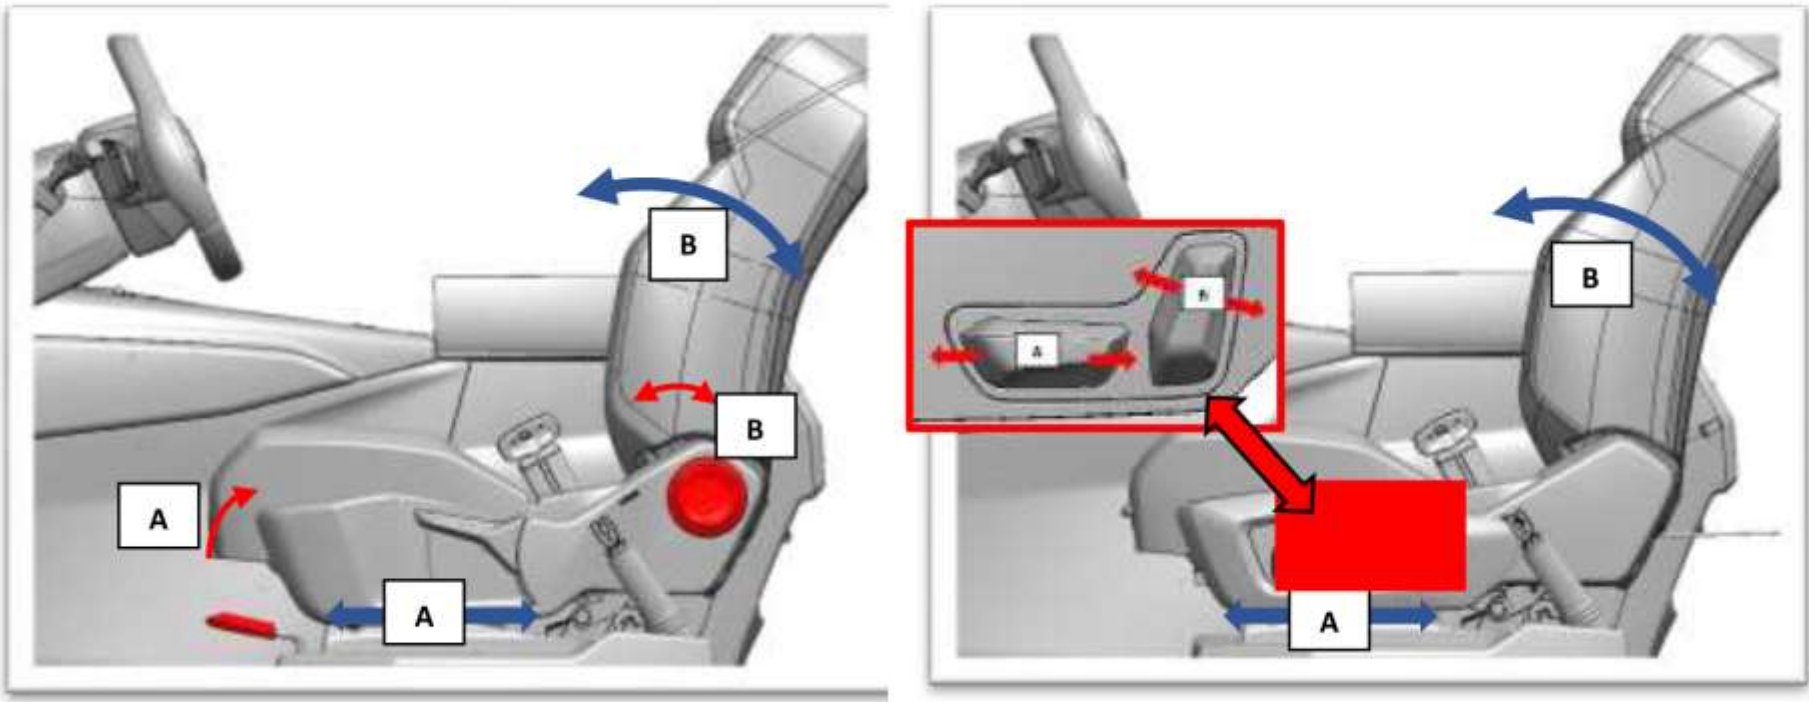



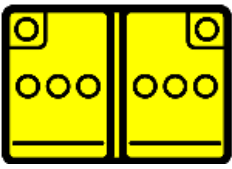

Steering column adjustment



Seat adjustment



5. Stored energy / liquids / gases / solids

| | | |
|---|---|--|
|  | 12V |    |
|  | 400V / Li-ion 73 kWh - 98 kWh (long range) |       |
|  | 1234 YF |  |



when coolant leaks from the battery pack, it can become unstable with risk of thermal runaway. Check battery pack temperature with thermal imaging camera.



6. In case of fire



Use large amount of water



RE-IGNITION POSSIBLE !




Lithium-ion batteries may self-ignite or reignite once the fire has been extinguished. Monitor the temperature of the high-voltage battery!



7. In case of submersion




3. Disable direct hazards / safety regulations


| | | | | |
|---|--|------------|--------------|------|
|  | ID N° | Version N° | Version date | Page |
| | JEEP_New Compass MY25 __SUV_2025_5d_Electric | 1 | 07.05.2025 | 4/5 |

8. Towing / transportation / storage

OK:





NOK:

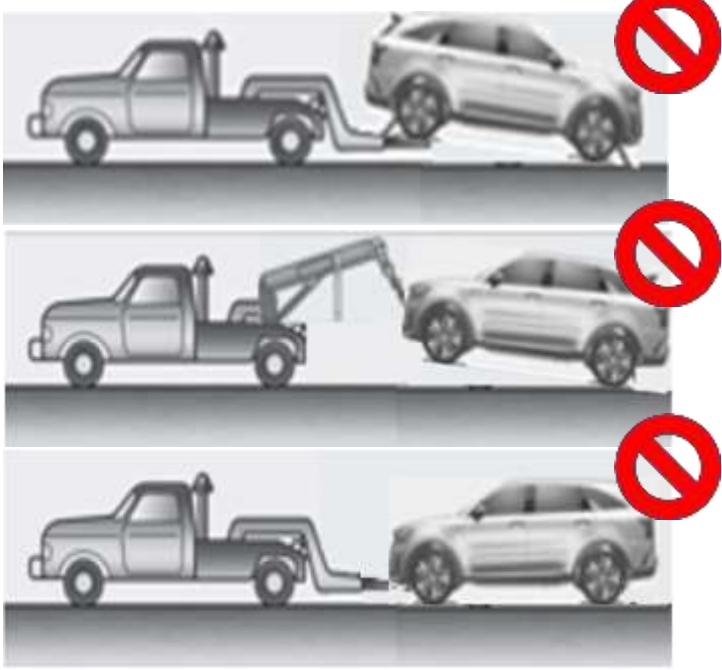


Location front hook

Location rear hook

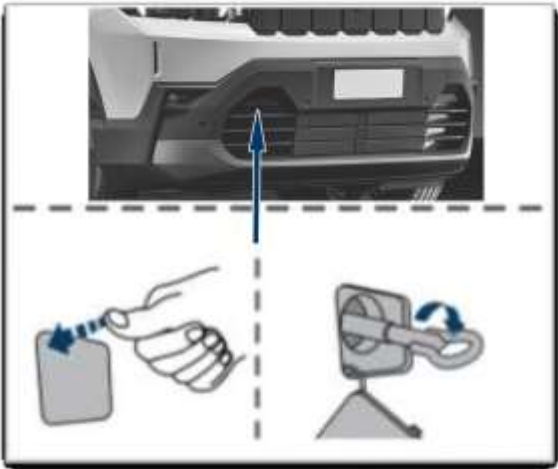

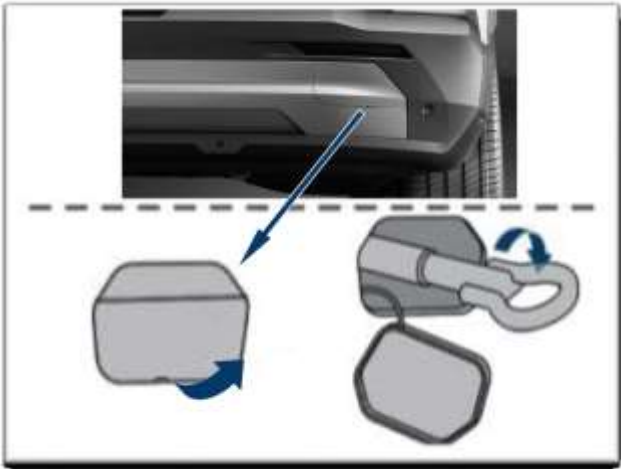


STORE AT SAFE DISTANCE FROM OTHER VEHICLES !





RE-IGNITION POSSIBLE !

9. Important additional information





12V

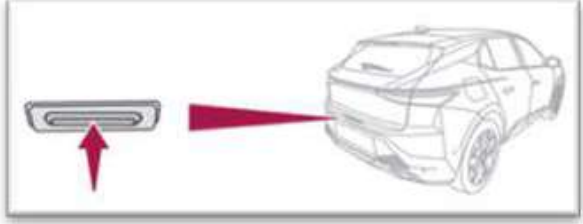





1XV

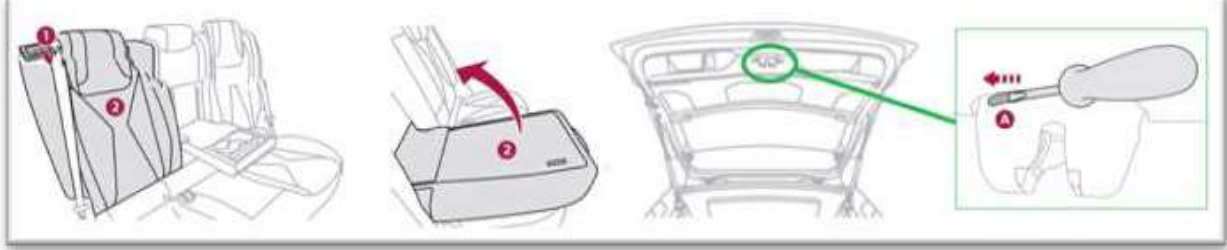






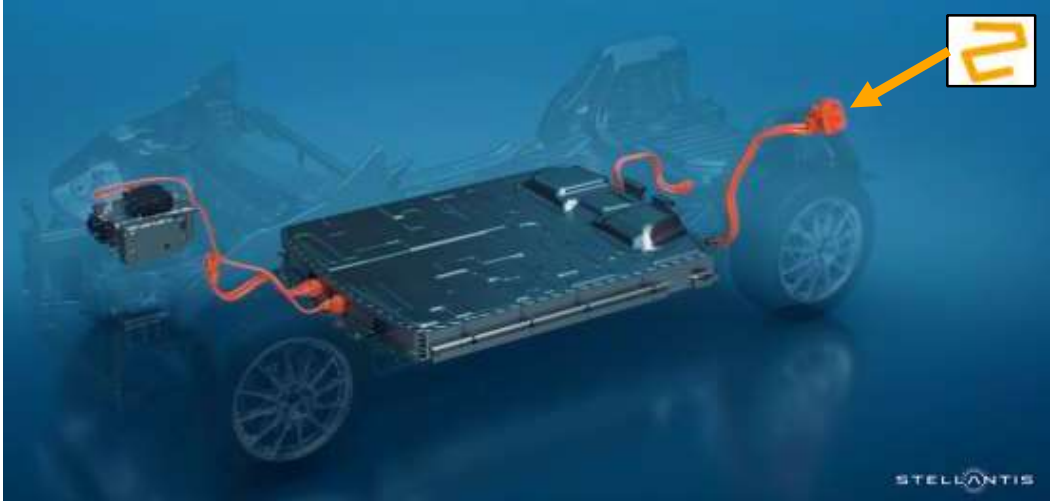










High voltage power cable





10. Explanation of pictograms used

| | | | |
|---|-----------------------------|--|----------------------------------|
|  | Remove smart key |  | Flammable |
|  | General warning sign |  | Hazardous to the human health |
|  | Warning; low temperature |  | Acute toxicity |
|  | Warning, Electricity |  | Explosive |
|  | Air-conditioning component |  | Corrosives |
|  | Electric Vehicle |  | Use water to extinguish the fire |
|  | Use thermal Infrared camera |  | Bonnet |